

SSM 50148 - 2021 Bronco – Multiple Warning Indicators / Messages In The IPC - Multiple Communication Fault DTCs Related To The HS2-CAN Network

Some 2021 Bronco vehicles may experience multiple warning indicators / messages displayed in the instrument panel cluster (IPC) and/or multiple communication fault diagnostic trouble codes (DTC) setting in and/or related to the HS2-CAN modules. This may be due to a loose and/or improperly seated connector C210. If the vehicle exhibits the above conditions, access and inspect connector C210 for proper attachment and/or damage and repair as necessary. To access the connector, remove the right side lower cowl side panel (follow Workshop Manual, (WSM) Section 415-00 > Removal and Installation > A-Pillar Speaker, Steps 9-10) and the glove compartment (follow WSM Section 501-12 > Removal and Installation > Glove Compartment). If this fault persists, refer to WSM Section 418-00A and continue with normal diagnostics.

APPLICABLE VEHICLES
2021 TRUCK: G1 U725N BRONCO